


IRG121 THERMOMETER OPERATING INSTRUCTIONS

The thermometer is a non-contact infrared thermometer, and always with Real-Time Maximum (MAX) data.

Please don't use it for safety-related applications.

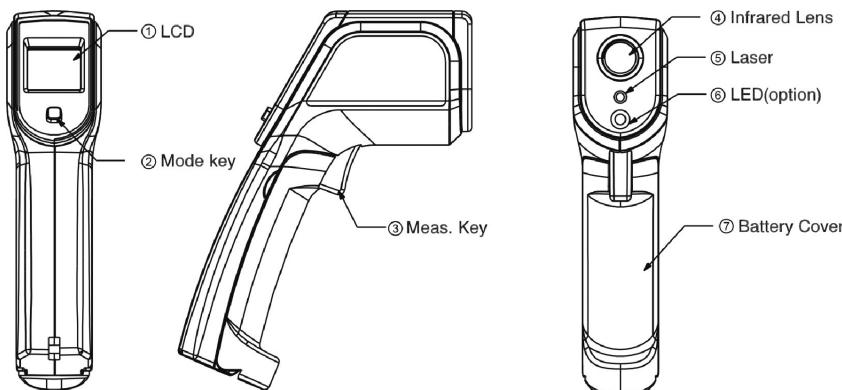

1. Simply aim the thermometer at the measure target with Lens (④) and press Meas. key (③) to display the surface temperature.
2. During the measurement, the MAX reading will be displayed beside the MAX icon.
3. The Distance: Spot is 12:1. Please make sure the target area is within the field of view.

ADD VALUE:

° C or ° F	Press Mode key (②) for ° C or ° F transferred.
Backlight	LCD Backlight: always on.
Laser	Class II Laser: always enable while measuring.

EMC/RFI. Readings may be affected if the unit is operated within radio frequency electromagnetic field strength of approximately 3 volts per meter, but the performance of the instrument will not be permanently affected.

* Note: Under the electromagnetic field of 3V/m from 350 to 550MHz, the maximum error is 8° C (14.4° F).

Storage & Cleaning. The thermometer should be stored at room temperature between -20 to +65° C (-4~149° F). The sensor lens is the most delicate part of the thermometer. The lens should be kept clean at all times. Care should be taken when cleaning the lens to use only a soft cloth or cotton swab with water or medical alcohol. Allow the lens to fully dry before using the thermometer. Do not submerge any part of the thermometer.



CAUTION

Failure to observe the following cautions could create a risk of injury.

Do not stare into beam eye damage may occur.

Prolonged exposure can cause damage to the eyes including blindness. Use extreme caution when operating the laser. Never point the device toward anyone's eyes.

TIMKEN
Where You Turn

LCD ERROR MESSAGES. The thermometer incorporates visual diagnostic messages as follows:

Er2
Er3

'Er2' is displayed when the thermometer is exposed to rapid changes in the ambient temperature.
'Er3' is displayed when the ambient temperature exceeds 0° C (32° F) or +50° C (122° F).
The thermometer should be allowed plenty of time (minimum 30 minutes) to stabilize to the working/room temperature.

Er

For any other error messages (5-9), it is necessary to reset the thermometer. To reset it, turn the instrument off, remove the battery and wait for a minimum of one minute. Reinsert the battery and turn on. If the error message remains, please contact the Service Department for further assistance.

Hi Lo

'Hi' or 'Lo' is displayed when the temperature being measured is outside of the measurement range.

BATTERIES. The thermometer incorporates visual low battery indication as follows:



'Battery OK':
measurements are possible



'Battery Low':
battery needs to be replaced,
measurements are still possible



'Battery Exhausted':
measurements are not possible

When the 'Low Battery' icon indicates the battery is low, the battery should be replaced immediately with AAA, 1.5V batteries. Please note: It is important to turn the instrument off before replacing the battery, otherwise the thermometer may malfunction. Dispose of used battery promptly.

SPECIFICATION

Measurement Range	-60 to +500° C (-76 to +932° F)
Operating Range	0~50° C (32~122° F)
Accuracy, (Tobj = 15~35° C, Tamb = 25° C)	+/-1.0° C (1.8° F)
Accuracy (Tamb = 23 +/- 3° C)	0~500° C: +/- 2% of reading or 2° C (4° F) whichever is greater -60~0° C: +/- (2° C + 0.05/degree)
Emissivity	0.95 fixed
Resolution (-9.9~199.9° C)	0.1° C/0.1° F
Response Time (90%)	1 sec
Distance: Spot	12:1
Battery Life	Typ.18, min 14 hours continuous use
Dimensions	46.0 x 143.0 x 184.8mm (1.81 x 5.63 x 7.28 inch)
Weight	240 grams (8.5 oz) including batteries (AAA*2pcs)

** The thermometer will automatically shut off if left idle for more than 15 sec.

Timken® is a registered trademark of
The Timken Company.

© 2008 The Timken Company
1M 09-08-29